Product Information

Strass 244

Strass adhesive 244 Valid for article no.: 1SK244

page 1 of 2

Telefon: +49 8341 / 62087 Telefax: +49 8341 / 65475 http://www.hasulith.com info@hasulith.de

SPECIFICATION DRYING Strass 244 is a special colourless, solvent-borne one-component The retarded drying of Strass 244 makes it possible to adjust the stones adhesive to glue glass-, strass- or simili-rhinestones (e.g. Swarovskito the correct position after gluing. This is possible up to 30 minutes after stones) with a diameter up to 5 mm (equivalent to Swarovski SS 22) to a setting the stones. After this time the stones should not be moved variety of materials. Strass 244 don't form threads on application and can anymore. be applicated dropwise. Drying time depends mainly on the size of the stones (the bigger the longer) and the ambient temperature. After about one hour the initial Dry Strass 244 is hard and crystal-clear, so gluing borders or some fastness of the gluing is already strong enough to handle the objects with excess of adhesive spilled on the stone will be nearly invisible. The dried Strass 244 will not turn yellow or brown on aging or exposure to light. some care (e.g. move them to another place). The gluing borders or excess of adhesive will not be wet or tacky anymore. For gluing of bigger stones (more than 5 mm in diameter) we recommend Maximum bond strength is achieved after about 48 hours - but within 24 to use our HASULITH® Cement Vielzweckkleber (Multi-purposehours usually the adhesive is already dry enough to pack and mail the Adhesive Art.-Nr. 1VZK). For very big resp. heavy stones or if the stones do not fit well to the recesses, settings or the substratum (please see the glued objects. In this case you should take care to pack the glued objects in a way that there is not to much mechanical stress on the glued stones. illustrations on the next page) we recommend to use our 2-Component-Adhesive HASULITH® Duo (Art. Nr. 1HDCV20L). Although the most common way is to let the gluing get dry on ambient temperature it's also possible to accelerate the drying of Strass 244 by **RECOMMENDED FOR THE GLUING OF** slight heat (recommended: max. 50°C). Because of the highly flammable solvents the oven have to be explosion-protected. Accelerated drying at higher temperatures can be done at the earliest after a pre-drying of at Strass-, glass-, or simili-rhinestones especially to metals - but also to least 4-5 hours at ambient temperature. If you put the glued objects to an materials like glass, ceramics, china and hard plastics like Polyacrylates. oven too early, there are still too many volatile solvents in the gluing area For gluing semi-precious-stones (e.g. lapis-lazuli, turquois...) Strass 244 and if they evaporate too quick, bubbles will appear in the gluing area and is only recommended if the stones are not lubricated or greased for better in the worst case the stones might be lifted out of the settings. gloss (but usually they are - please ask your stone supplier). Not recommended for gluings on materials like Polystyrene, PVC, SEPARATION OF GLUED PARTS/CLEANING Styropor®, PE, PP, rubber, Nylon or other kind of soft plastics or flexible materials like fabrics, leather etc. From metal, glass or ceramic objects stones can be removed by dipping the whole object in our Thinner 1002 (Art.-Nr. 3V1002) for a while. Plastic stones can not be glued with Strass 244 because the solvents in Usually the mirror on the backside of the stones will be not attacked by the adhesive will attack the plastic stones. For gluing plastic stones we this procedure but as a precaution the object should not be dipped longer recommend our solvent-free HASULITH® Dispersion Glue P (Art. Nr. than necessary. Please notice, that lacquers, paint or plastics (or other 1PMK). This glue is also recommended to glue glass- or similisolvent-sensitive parts) on the objects might be removed resp. attacked rhinestones to a variety of plastics. by the thinner as well. **APPLICATION** SAFETY Attention ! On using the tubes the plastic cap have to be unscrewed first. Then the metal membrane of the tube have to be pierced with a pointed utensil (e.g. a nail or a pointed knife). The gluing areas have to be dry and clean -(free from dust, grease,oil,lubricants and other abherents). For optimum gluing results it is important, that the stones fit well to the settings resp. the substratum (please see the illustrations on page 2). highly flammable irritant For application Strass 244 is put to the settings. Because the drying of Strass 244 take place with some minutes R 11-36-66-67 retardation it is possible to put the adhesive to about 25 settings first and S 2-7/9-16-20/21-23-24/25-26 subsequently set the stones to the settings - in other words: it is not necessary to set a stone immediately after putting on the adhesive. When Highly infammable. Irritating to eyes. Keep out of reach of children. Keep all stones of an object are set, the stones have to be pressed down away from sources of heat or ignition. Don't smoke, eat or drink on slightly to the settings (e.g. with a toothpick) and - if necessary - adjusted working. Use only in thoroughly ventilated areas.Don't breathe the vapours and wear goggles for eye protection. After swallowing: see a to the desired position. physician immediately. Because Strass 244 becomes crystal clear and hard on drying it's usually not necessary to remove excess adhesive spilled on the stone or object. WARNING: Intentional misuse by deliberately inhaling the vapours from this product can be harmful or fatal. The application of Strass 244 can take place e.g. directly from the tube or with a PE-plastic bottle with a nozzle, by a syringe with needle or with a toothpick.

The informations and statements herein (as well as any other informations and recommendations from our side) are believed to be reliable and true but are not to be construed as a warranty or representation for which we assume legal responsibility. Users should undertake sufficient verification and testing to determine the suitability for their own particular purpose of any information or products referred to herein... No liability for the consequences of wrong application. If there should be any liability from our side, this liability is limited to the value of the delivered goods. No warranty or fitness for a particular purpose can be made.Nothing herein is to be taken as permission, inducement or recommendation to practice any patented invention without a license.

Product Information

Strass 244

Strass adhesive 244 Valid for article no.: 1SK244

page 2 of 2

Sussmann & Steinhauser GmbH Glasschleiferstrasse 14 D-87600 Kaufbeuren

Telefon: +49 8341 / 62087 Telefax: +49 8341 / 65475 http://www.hasulith.com info@hasulith.de

STORAGE / HANDLING / WASTE

Strass 244 should be stored well closed in a cool, dark and dry place not together with foodstuff or drugs. In tubes Strass 244 can be stored for a few years. In PE-plastic containers the adhesive will get a little bit thicker after several month because some loss of solvents by diffusion through the PE will occur (especially if stored too warm in small containers). Also frequent opening of the container will lead to some loss of solvents. In this case some Thinner 1002 (Art.-Nr. 3V1002) can be added until the adhesive get back the original viscosity.

Completely dry adhesive residues in small amounts can be wasted with the household rubbish. Bigger quantities or not completely dry adhesive Illustration b) have to be wasted as hazardous waste according to the local regulations.

AVAILABLE CONTAINERS

1SK244-T	tube	20 ml
-К	box with 100 tubes	100 x 20 ml
-8	PE-bottle with nozzle	80 ml
-2	PE-refill-bottle with nozzle	2.000 ml
-10	PE-canister	10 ltr
-025W	PE-wide neck bottle	250 ml
-050W	PE-wide neck bottle	500 ml
-1W	PE-wide neck bottle	1.000 ml

Other units or bulk quantities on request. For resellers Strass 244 is also available in containers without label or we can label and pack it according to customers demand. On a minimum order of 10 000 tubes Strass 244 can be supplied indiviually printed according to customers demands.

APPENDIX - SOME IMPORTANT HINTS FOR THE GLUING OF STONES WITH STRASS 244


For getting the optimum fastness and best bond strength, the stones should fit to the settings as good as possible - like shown in illustration a). If there are too strong deviations like shown in illustration b), c) and d) no satisfactory results can be expected.

In case of illustration c) resp. d) good results can be obtained if a twocomponent adhesive (e.g. our HASULITH Duo) is used for the gluing. Only a two-component adhesive is able to fill the big gap between stone and setting completely.


In case of illustration b) using a two-component adhesive will lead to better but maybe not totally satisfactory results because the point of weakness on the side part of the stone will remain.

Problems also may occur if flat back stones are glued on strong curved areas. In this case also the gluing area is very small and the gap between stone bottom and substratum too big. In this case a high viscous or thixotropic two-component adhesive (e.g. UHU plus endfest 300 or our HASULITH Duo modified with Thixotropic Additive 1384) should be used to obtain the maximum fastness.

Regarding the guality of simili-rhinestones it is important that the metal mirror and the protective bronze-coating on the bottom of the stone have good adhesion to each other resp. the stone. If this adhesion is bad even the strongest adhesive can not prevent the stone from coming out. Bad adhesion between glass and mirror becomes obvious when the rhinestone comes out and the mirror will stick together with the adhesive to the setting. Wrongly this is interpreted sometimes as a lack of bonding strength of the adhesive. (Actually in this case the bonding strength of the adhesive is very good - just the adhesion between the glass and the mirror is too weak).

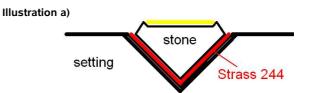


Ideal case of a gluing. The stone fits well to the setting. Maximum gluing area - optimum adhesion and bond strength.

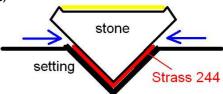


The stone is too big and stands out of the setting so the gluing have some point of weakness -especially against mechanical stress to the side parts. The gluing area is comparatively small. Some bending or peeling stress to the stone and it will come out.

Illustration c)

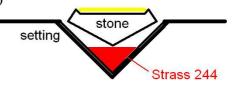

The angle of the stone is very different to the angle of the setting. Most of the adhesive collect at the bottom of the setting. Almost no or very small gluing area. Some push or bump to the object and the stone will jump out.

Illustration d)

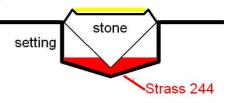

Cylindrical setting. The adhesive collect at the bottom of the setting. Gap filling not possible. Almost no or very small gluing area.

The informations and statements herein (as well as any other informations and recommendations from our side) are believed to be reliable and true but are not to be construed as a warranty or representation for which we assume legal responsibility. Users should undertake sufficient verification and testing to determine the suitability for their own particular purpose of any information or products referred to herein.. No liability for the consequences of wrong application. If there should be any liability from our side, this liability is limited to the value of the delivered goods. No warranty of fitness for a particular purpose can be made. Nothing herein is to be taken as permission, inducement or recommendation to practice any patented invention without a license